

**SAFETY DATA SHEET**



**CROWN ALLOYS COMPANY**

**Section 1 – PRODUCT AND COMPANY IDENTIFICATION**

**PRODUCT NAME:** High Strength Bare Wire  
**PRODUCT IDENTIFICATION:** ROYAL 220-TIG, ROYAL 220-MIG  
**RECOMMENDED USE:** GTAW (Gas Tungsten Arc Welding) and GMAW (Gas Metal Arc Welding)  
**SPECIFICATION:** N/A  
**SUPPLIER:** Crown Alloys Company  
30105 Stephenson Hwy.  
Madison Heights, MI. 48071  
**TELEPHONE NUMBER:** (248) 588-3790  
**EMERGENCY NUMBER:** Call CHEMTREC Day or Night 1-800-424-9300 / +1 703-527-3887  
**WEBSITE:** [www.crownalloys.com](http://www.crownalloys.com)

**Section 2 – HAZARDS IDENTIFICATION**

**2.1 Classification of the mixture**

This product is placed on the market in solid form

**2.1.1 Classification in accordance with GHS-US**

Acute Tox. 4 (Oral)	H302	STOT RE 1	H372
Skin Sens. 1	H317	Aquatic Acute 1	H400
Carc. 1B	H350	Aquatic Chronic 3	H412

**2.2 Label elements**

**GHS-US labelling**

**Hazard Pictograms (GHS-US):**



GHS07



GHS08



GHS09

**Signal word (GHS-US):**

Danger

**Hazard statements (GHS-US):**

H302 – Harmful if swallowed

H317 – May cause an allergic skin reaction

H350 – May cause cancer

H372 – Causes damage to organs through prolonged or repeated exposure

H400 – Very toxic to aquatic life

H412 – Harmful to aquatic life with long lasting effects

**Precautionary statements (GHS-US):**

P201 – Obtain special instructions before use

P202 – Do not handle until all safety precautions have been read and understood

P260 – Do not breathe dust/fume/gas/mist/vapors/spray

P261 – Avoid breathing dust/fume/gas/mist/vapors/spray

P264 – Wash thoroughly after handling

P270 – Do not eat, drink or smoke when using this product

P272 – Contaminated work clothing should not be allowed out of the workplace

P273 – Avoid release to the environment

P280 – Wear protective gloves/protective clothing/eye protection/face protection

P301+P312 – If swallowed: Call a poison center or physician if you feel unwell

P302+P352 – IF ON SKIN: Wash with plenty of soap and water

P308+P313 – IF EXPOSED OR CONCERNED: Get medical advice/attention

P314 – Get medical advice and attention if you feel unwell

P321 – Specific treatment (see label)

P330 – If swallowed, rinse mouth

P333+P313 – If skin irritation or rash occurs: Get medical advice/attention

P362+P364 – Take off contaminated clothing and wash it before reuse

P391 – Collect spillage

P405 – Store locked up

P501- Dispose of contents/container in accordance with local/regional/national/international regulations

**2.3 Other hazards**

No additional information available

**2.4 Unknown acute toxicity (GHS-US)**

No data available

**SAFETY DATA SHEET**



**Other hazards which do not result in GHS classification:**

Electrical shock can kill.  
 Arc rays can injure eyes and burn skin.  
 Welding arc and sparks can ignite combustibles and flammable materials.  
 Overexposure to welding fumes and gases can be hazardous.  
 Read and understand the manufacturer's instructions, Safety Data Sheets and the precautionary labels before using these alloys. Refer to Section 8.

**Substance(s) formed under the conditions of use:**

The welding fumes produced from these welding alloys may contain the following constituent(s) and/or their complex metallic oxides as well as solid particles or other constituents from the consumables, base metal, or base metal coating not listed below:

Chemical Identity	CAS-No.	Chemical Identity	CAS-No.	Chemical Identity	CAS-No.
Carbon Dioxide	124-38-9	Ozone	10028-15-6	Nickel	7440-02-0
Carbon Monoxide	630-08-0	Manganese	7439-96-5	Chromium Oxide	1308-38-9
Nitrogen Dioxide	10102-44-0	Chromium (VI)	18540-29-9		

**Section 3 – COMPOSITION / INFORMATION ON INGREDIENTS**

**3.1 Substances**

Not applicable

Full text of H-phrases: See section 16

**3.2 Mixture**

**Reportable Hazardous Ingredients**

Chemical Identity	CAS-No.	Weight Percent (%)	GHS-US Classification
Carbon	7440-44-0	0.20 max.	Not classified
Chromium and chromium alloys or compounds (as Cr)	7440-47-3	12.0 – 35.0	Comb. Dust
Copper (Cu)	7440-50-8	4.00 max.	Comb. Dust Aquatic Acute 1, H400 Aquatic Chronic 3, H412
Iron (Fe)	7439-89-6	40.0 – 70.0	Acute Tox. 4 (Oral), H302
Manganese (Mn)	7439-96-5	1.00 – 5.00	Comb. Dust
Molybdenum (Mo)	7439-98-7	0.10 – 1.50	Comb. Dust
Nickel (Ni)	7440-02-0	2.00 – 15.0	Skin Sens. 1, H317 Carc. 1B, H350 STOT RE 1, H372
Silicon (Si)	7440-21-3	0.10 – 1.50	Not classified

**Composition Comments:** The term "Hazardous Ingredients" should be interpreted as a term defined in Hazard Communication standards and does not necessarily imply the existence of a welding hazard. These alloys may contain additional non-hazardous ingredients or may form additional compounds under the condition of use. Refer to Sections 2 & 8 for more information.

**Section 4 – FIRST AID MEASURES**

**4.1 Description of first aid measures**

**Ingestion:** Unlikely due to the form of the product. Avoid hand, clothing, food, and drink contact with metal fume or powder which can cause ingestion of particulate during hand to mouth activities such as drinking, eating, smoking, etc. If ingested, do not induce vomiting. Contact a poison control center. If symptoms develop, seek medical attention at once.

**Inhalation:** Remove to fresh air. If not breathing, give artificial respiration. Seek medical assistance immediately.

**Skin Contact:** Flush with water for at least 15 minutes. For reddened or blistered skin, or thermal burns, obtain medical assistance.

**Eye Contact:** Dust or fume from these alloys should be flushed from the eyes with clean, tepid water until transported to a medical facility. Do not rub eyes or keep eyes tightly closed. Obtain immediate medical assistance.  
 Arc rays can injure eyes. If exposed, move victim to a dark room, remove contact lenses and cover eyes with a padded dressing and rest. Obtain medical assistance if symptoms persist.

**4.2 Most important symptoms/effects, acute and delayed**

**Symptoms/injuries after inhalation:** Short-term (acute) overexposure to the gases, fumes, and dusts may include irritation of the eyes, lungs, nose, and throat. Some toxic gases associated with welding may cause pulmonary edema, asphyxiation, and death. Acute overexposure may include signs and symptoms such as watery eyes, nose and throat irritation, headache, dizziness, difficulty in breathing, frequent coughing, or chest pain. The presence of chromium/chromate in fume can cause irritation of nasal membranes and skin. The presence of nickel compounds in fume can cause metallic taste, nausea, tightness of chest, fever, and allergic reaction. Excessive inhalation or ingestion of manganese can produce manganese poisoning. Overexposure to manganese compounds may affect the central nervous system, symptoms of which are languor, sleepiness, muscular weakness, emotional disturbances, and spastic gait resembling Parkinsonism. These symptoms can become progressive and permanent if not treated. Excessive inhalation of fumes may cause "Metal Fume Fever" with Flu-like symptoms such as chills, fever, body aches, vomiting, sweating, etc.

**SAFETY DATA SHEET**



**CROWN ALLOYS COMPANY**

**Symptoms/injuries after skin contact:** Dusts may cause irritation.  
**Symptoms/injuries after eye contact:** Causes eye irritation.  
**Symptoms/injuries after ingestion:** Not an anticipated route of exposure during normal product handling. May be harmful if ingested.

**4.3 Indication of immediate medical attention and special treatment needed**

No additional information available

**Section 5 – FIRE-FIGHTING MEASURES**

**General Fire Hazards:** As shipped, this product is nonflammable. However, welding arc and sparks can ignite combustibles and flammable products. Read and understand American National Standard Z49.1, "Safety In Welding, Cutting and Allied Processes" and National Fire Protection Association NFPA 51B, "Standard for Fire Prevention During Welding, Cutting and Other Hot Work" before using this product.

**5.1 Extinguishing media**

**Suitable extinguishing media:** Use extinguishing media appropriate for surrounding fire.  
**Unsuitable extinguishing media:** None

**5.2 Special hazards arising from the substance**

**Fire hazard:** Not flammable.  
**Explosion hazard:** None known.

**5.3 Special protective equipment and precautions for firefighters**

**Special firefighting procedures:** Use standard firefighting procedures and consider the hazards of other involved materials.  
**Special protective equipment for firefighters:** Firefighters should wear full protective gear.

**Section 6 – ACCIDENTAL RELEASE MEASURES**

**6.1 Personal precautions, protective equipment and emergency procedures**

If airborne dust and/or fume is present, use adequate engineering controls and, if needed, personal protection to prevent overexposure. Refer to recommendations in Section 8.

**6.2 Environmental precautions**

Avoid release to the environment

**6.3 Methods and material for containment and cleaning up**

Clean up spills immediately, observing precautions in the personal protective equipment in Section 8. Avoid generating dust. Prevent product from entering any drains, sewers or water sources. Refer to Section 13 for proper disposal. Attempt to reclaim the product if possible.

**Section 7 – HANDLING AND STORAGE**

**7.1 Precautions for safe handling**

Avoid inhaling welding fumes. Keep formation of airborne dusts to a minimum. Provide appropriate exhaust ventilation at places where dust is formed. Read and understand the manufacturer's instruction and the precautionary label on the product. See American National Standard Z49.1, "Safety In Welding, Cutting and Allied Processes" published by the American Welding Society, <http://pubs.aws.org> and OSHA Publication 2206 (29CFR1910), U.S. Government Printing Office, [www.gpo.gov](http://www.gpo.gov).

**7.2 Conditions for safe storage, including any incompatibilities**

Store in closed original container in a dry place. Store away from incompatible materials. Store in accordance with local/regional/national regulations.

**7.3 Specific end use(s)**

For welding consumables and related products

**Section 8 – EXPOSURE CONTROLS / PERSONAL PROTECTION**

**8.1 Control parameters**

Chemical Identity (CAS-No.)	ACGIH TLV (TWA)	OSHA PEL (TWA)	NIOSH REL	NIOSH STEL
<b>Chromium</b> (7440-47-3)	0.5 mg/m <sup>3</sup> [metal compound as Cr] 0.05 mg/m <sup>3</sup> [Cr(VI) inorganic compounds as Cr, water soluble] 0.01 mg/m <sup>3</sup> [Cr(VI) inorganic compounds as Cr, water insoluble]	1.0 mg/m <sup>3</sup> [metal compound as Cr] 0.005 mg(5 µg)/m <sup>3</sup> [Cr(VI) inorganic compounds as Cr(VI), water soluble] 0.005 mg(5 µg)/m <sup>3</sup> [Cr(VI) inorganic compounds as Cr(VI), insoluble]	0.5 mg/m <sup>3</sup>	N/A
<b>Copper</b> (7440-50-8)	0.2 mg/m <sup>3</sup> (fume, as Cu) 1.0 mg/m <sup>3</sup> (dust and mists, as Cu)	0.1 mg/m <sup>3</sup> (fume, as Cu) 1.0 mg/m <sup>3</sup> (dust and mist, as Cu)	N/A	N/A
<b>Iron</b> (7439-89-6)	5.0 mg/m <sup>3</sup> (as Fe <sub>2</sub> O <sub>3</sub> ) respirable fraction	10.0 mg/m <sup>3</sup> (fume, as Fe <sub>2</sub> O <sub>3</sub> )	N/A	N/A

**SAFETY DATA SHEET**



**CROWN ALLOYS COMPANY**

Chemical Identity (CAS-No.)	ACGIH TLV (TWA)	OSHA PEL (TWA)	NIOSH REL	NIOSH STEL
<b>Manganese</b> (7439-96-5)	0.02 mg/m <sup>3</sup> (elemental and inorganic compounds, as Mn – respirable fraction) 0.1 mg/m <sup>3</sup> (elemental and inorganic compounds, as Mn – inhalable fraction)	5.0 mg/m <sup>3</sup> (fume, as Mn) Ceiling	1 mg/m <sup>3</sup>	3 mg/m <sup>3</sup>
<b>Molybdenum</b> (7439-98-7)	3.0 mg/m <sup>3</sup> (respirable fraction, as Mo) 10.0 mg/m <sup>3</sup> (inhalable fraction, as Mo)	15.0 mg/m <sup>3</sup> (total dust, as Mo)	N/A	N/A
<b>Nickel</b> (7440-02-0)	1.5 mg/m <sup>3</sup> as metal (inhalable fraction)	1.0 mg/m <sup>3</sup> (metal and insoluble compounds as Ni)	0.015 mg/m <sup>3</sup>	N/A
<b>Silicon</b> (7440-21-3)	Withdrawn	15.0 mg/m <sup>3</sup> (total dust) 5.0 mg/m <sup>3</sup> (respirable fraction)	5.0 mg/m <sup>3</sup> (respirable) 10.0 mg/m <sup>3</sup> (total)	N/A

**8.2 Exposure controls**

**Appropriate Engineering Controls:**

Use enough ventilation, local exhaust at the arc, or both to keep the fumes and gases from the worker's breathing zone & the general area. Maintain exposures below acceptable exposure levels (see Section 8.1). Use industrial hygiene air monitoring to ensure that your use of these products does not create exposures that exceed the recommended exposure limits. Always use exhaust ventilation in user operations such as high temperature cutting, grinding, welding and brazing. Train the welder to keep his head out of the fume plume. Confined spaces require adequate ventilation and/or air supplied respirators. Read and understand the manufacturer's instructions and the precautionary label on the product. See American National Standard Z49.1, Safety in Welding, Cutting, and Allied Processes, published by the American Welding Society, 8669 Doral Blvd. Suite 130, Doral, FL 33166 and OSHA Publication 2206 (29CFR1910), US Government Printing Office, Washington, D.C. 20402 for more details on many of the following.

**General information:**

**Exposure Guidelines:** Threshold Limit Values (TLVs) and Biological Exposure Indices (BEIs) are values published by the American Conference of Government Industrial Hygienists (ACGIH). ACGIH Statement of Positions Regarding the TLVs® and BEIs® states that the TLV-TWA should be used as a guide in the control of health hazards and should not be used to indicate a fine line between safe and dangerous exposures. See Section 10 for information on potential fume constituents of health interest. Threshold Limit Values are figures published by the American Conference of Government Industrial Hygienists.

**Eye/face protection:**

Wear helmet or use face shield with filter lens shade number 12 or darker for open arc processes. No specific lens shade recommendation for submerged arc processes. Shield others by providing screens and flash goggles.

**Skin/Hand Protection:**

Wear protective gloves. Suitable gloves can be recommended by the glove supplier.

**Protective Clothing:**

Wear hand, head, and body protection which help to prevent injury from radiation, sparks and electrical shock. See Z49.1. At a minimum this includes welder's gloves and a protective face shield, and may include arm protectors, aprons, hats, shoulder protection, as well as dark substantial clothing. Wear dry gloves free of holes or split seams. Train the welder not to permit electrically live parts or electrodes to contact skin . . . or clothing or gloves if they are wet. Insulate yourself from the work piece and ground using dry plywood, rubber mats or other dry insulation.

**Respiratory Protection:**

Keep your head out of fumes. Use enough ventilation and local exhaust to keep fumes and gases from your breathing zone and the general area. An approved respirator should be used unless exposure assessments are below applicable exposure limits. Use respirable fume respirator or air supplied respirator when welding in confined space or where local exhaust or ventilation does not keep exposure below TLV's (see Section 8.1). Use only NIOSH approved respirators in accordance with 29 CFR 1910.134 – Respiratory Protection. Oxygen levels below 19.5% are considered IDLH by OSHA. In such atmospheres, use of a full-facepiece pressure/demand SCBA or a full facepiece, supplied air respirator with auxiliary self-contained air supply is required under OSHA's Respiratory Protection Standard (1910.134-1998).

**Hygiene measures:**

Do not eat, drink or smoke when using the product. Always observe good personal hygiene measures, such as washing after handling the material and before eating, drinking, and/or smoking. Cosmetics should not be applied in areas where exposures exist! Routinely wash work clothing and protective equipment to remove contaminants.

Determine the composition and quantity of fumes and gases to which workers are exposed by taking an air sample from inside the welder's helmet if worn or in the worker's breathing zone. Improve ventilation if exposures are not below limits. See ANSI/AWS F1.1, F1.2, F1.3 and F1.5, available from the American Welding Society, www.aws.org.

**Section 9 – PHYSICAL AND CHEMICAL PROPERTIES**

<b>Appearance</b>	Solid welding wire or rod
<b>Physical state</b>	Solid
<b>Form</b>	Solid
<b>Color</b>	Metallic
<b>Odor</b>	No data available
<b>Odor threshold</b>	No data available
<b>pH</b>	Not applicable
<b>Melting point/freezing point</b>	No data available
<b>Flammability (solid, gas)</b>	No data available
<b>Flash Point</b>	Not applicable
<b>Evaporation rate</b>	Not applicable
<b>Initial boiling point and boiling range</b>	No data available

<b>Flammability limit - upper (%)</b>	No data available
<b>Flammability limit - lower (%)</b>	No data available
<b>Explosive limit - upper (%)</b>	No data available
<b>Explosive limit - lower (%)</b>	No data available
<b>Vapor pressure</b>	Not applicable
<b>Vapor density</b>	Not applicable
<b>Relative density</b>	No data available
<b>Solubility in water</b>	No data available
<b>Solubility (other)</b>	No data available
<b>Partition coefficient (n-octanol/water)</b>	No data available
<b>Auto-ignition temperature</b>	No data available
<b>Decomposition temperature</b>	No data available
<b>Viscosity</b>	Not applicable

**SAFETY DATA SHEET**



**Section 10 – STABILITY AND REACTIVITY**

**10.1 Reactivity**

This product is non-reactive under normal conditions of use, storage and transport.

**10.2 Chemical stability**

This product is stable under normal conditions.

**10.3 Possibility of hazardous reactions**

Will not occur.

**10.4 Conditions to avoid**

Uncontrolled exposure to extreme temperatures and incompatible materials.

**10.5 Incompatible materials**

Strong acids, strong oxidizers, mineral acids, some halogenated compounds, phosphorus and mercury.

**10.6 Hazardous decomposition products**

Welding/brazing fumes and gases can't be classified simply. The composition and quantity of both are dependent upon the metal being welded/brazed and the rods used. Coatings on the metal being welded/brazed (such as paint, plating, or galvanizing), the number of welders, the volume of the work area, the quality and the amount of ventilation, the position of the welder's head with respect to the gas plume, the presence of contaminants in the atmosphere (such as chlorinated hydrocarbon vapors from cleaning and degreasing activities), the process and procedures, as well as the welding/brazing consumables.

When the Royal 220-TIG and/or Royal 220-MIG are/is consumed, the fume and gas decomposition products generated are different in percent and form from the ingredients listed in Section 3. Decomposition products of normal operation include those originating from the volatilization, reaction, or oxidation of the materials shown in Section 3, plus those from the base metal, coatings, etc., as noted above. Gaseous reaction products may include carbon monoxide and carbon dioxide. Ozone and nitrogen oxides may be formed by the radiation from an arc, in addition to the shielding gases like argon and helium, whenever they are employed. Reasonably expected fume constituents of the Royal 220-TIG and/or Royal 220-MIG would include: Complex oxides of iron, manganese, silicon, chromium, nickel, molybdenum, copper, carbon dioxide, carbon monoxide, ozone and nitrogen oxides. The fume limit for chromium, nickel and/or manganese may be reached before the general welding fume limit of 5 mg/m<sup>3</sup> is reached. One recommended way to determine the composition and quantity of fumes and gases to which workers are exposed is to take an air sample inside the welder's helmet if worn or in the worker's breathing zone. See ANSI/AWS F1.1 "Method for Sampling Airborne Particles Generated by Welding and Allied Processes" and "Characterization of Arc Welding Fume" available from the American Welding Society, 8669 Doral Blvd. Suite 130, Doral, FL 33166.

**A SIGNIFICANT AMOUNT OF THE CHROMIUM IN THE FUMES CAN BE HEXAVALENT CHROMIUM , ALSO KNOWN AS Cr(VI), WHICH HAS A VERY LOW EXPOSURE LIMIT OF 0.005 mg/m<sup>3</sup> (5 µg/m<sup>3</sup>).**

Monitor fume levels and Cr(VI) level. Train workers about the hazards of Cr(VI). **Read and comply with OSHA's permissible exposure limits for hexavalent chromium Cr(VI), Fed. Reg. 71 – 10099 (specifically 29 CFR 1910.1026, 29 CFR 1915.1026, and 29 CFR 1926.1126).** For Cr(VI), OSHA requires: "The employer shall perform initial monitoring to determine the 8-hour TWA exposure for each employee on the basis of a sufficient number of personal breathing zone air samples to accurately characterize full shift exposure on each shift, for each job classification, in each work area". Specialized equipment is required for monitoring Cr(VI) concentration in the workplace. OSHA Analytical Method Number ID-215 for area and breathing zone sampling and OSHA Analytical Method Number W4001 for wipe samples are listed on the OSHA website – [www.osha.gov](http://www.osha.gov) – as methods for measuring Cr(VI). This standard is complex and the employer should contact an occupational health professional for doing the Cr(VI) monitoring and all other fume monitoring.

**EU RoHS (European Union Restriction of Hazardous Substances): The Royal 220-TIG and Royal 220-MIG rods/wires contain Chromium. During welding these alloys will produce Cr(VI) (hexavalent chromium), however, the weld deposit does not contain Cr(VI) as it will all be in the zero valent state or as Cr(III) as an oxide. FINISHED PRODUCTS MANUFACTURED USING THE ROYAL 220-TIG and/or ROYAL 220-MIG WILL NOT CONTAIN ANY Cr(VI).**

**Section 11 – TOXICOLOGICAL INFORMATION**

**Information on likely routes of exposure**

- Ingestion:** Health injuries from ingestion are not known or expected under normal use.
- Inhalation:** Potential chronic health hazards related to the use of welding consumables are most applicable to the inhalation route of exposure. Refer to Inhalation statements in this section.
- Skin Contact:** Arc rays can burn skin. Skin cancer has been reported.
- Eye contact:** Arc rays can injure eyes.

**Symptoms related to the physical, chemical and toxicological characteristics**

- Inhalation:** Short-term (acute) overexposure to welding fumes may result in discomfort such as metal fume fever, dizziness, nausea, or dryness or irritation of nose, throat, or eyes. May aggravate pre-existing respiratory problems (e.g. asthma, emphysema). Long-term (chronic) overexposure to welding fumes can lead to siderosis (iron deposits in lung), central nervous system effects, bronchitis and other pulmonary effects.

**Information on toxicological effects**

**Acute toxicity** (list all possible routes of exposure): Harmful if swallowed

<b>Specified substance: MANGANESE</b> LD50 (oral, rat) = 9000 mg/kg ATE (oral) = 9000000.0 mg/kg	<b>Specified substance: IRON</b> LD50 (oral, rat) = 98.6 g/kg ATE (oral) = 984.00 mg/kg	<b>Specified substance: NICKEL</b> LD50 (oral, rat) >9000mg/kg
--	---	---

**SAFETY DATA SHEET**



**CROWN ALLOYS COMPANY**

<b>Repeated dose toxicity (product):</b>	Not classified
<b>Skin corrosion/irritation (product):</b>	Not classified
<b>Serious eye damage/irritation (product):</b>	Not classified
<b>Respiratory or skin sensitization (product):</b>	May cause an allergic skin reaction
<b>Germ cell mutagenicity (product):</b>	Not classified
<b>Carcinogenicity (product):</b>	May cause cancer

<b>Chromium (7440-47-3)</b>	
International Agency for Research on Cancer (IARC) Monographs	3 (Not classifiable as to its carcinogenicity to humans)
<b>Nickel (7440-02-0)</b>	
International Agency for Research on Cancer (IARC) Monographs	2B (Possibly carcinogenic to humans)
National Toxicology Program (NTP) Status	Reasonably anticipated to be a Human Carcinogen

<b>Reproductive toxicity (product):</b>	Not classified
<b>Specific target organ toxicity - single exposure (product):</b>	Not classified
<b>Specific target organ toxicity - repeated exposure (product):</b>	Causes damage to organs through prolonged or repeated exposure
<b>Aspiration hazard (product):</b>	Not classified

**Other Effects:** Organic polymers may be used in the manufacture of various welding consumables. Overexposure to their decomposition byproducts may result in a condition known as polymer fume fever. Polymer fume fever usually occurs within 4 to 8 hours of exposure with the presentation of flu like symptoms, including mild pulmonary irritation with or without an increase in body temperature. Signs of exposure can include an increase in white blood cell count. Resolution of symptoms typically occurs quickly, usually not lasting longer than 48 hours.

**Symptoms related to the physical, chemical and toxicological characteristics under the condition of use:**

<p><b>Specified substance: CHROMIUM (VI)</b>  <b>Inhalation:</b>          Chromates may cause ulceration, perforation of the nasal septum, and severe irritation of the bronchial tubes and lungs. Liver damage and allergic reactions, including skin rash, have been reported. Asthma has been reported in some sensitized individuals. Skin contact may result in irritation, ulceration, sensitization, and contact dermatitis. Chromates contain the hexavalent form of chromium [Chromium (VI)]. Hexavalent chromium and its compounds are on the IARC and NTP lists as posing a cancer risk to humans.</p>	<p><b>Specified substance: MANGANESE</b>  <b>Inhalation:</b>          Overexposure to manganese fumes may affect the brain and central nervous system, resulting in poor coordination, difficulty speaking, and arm or leg tremors. This condition can be irreversible.</p> <p><b>Specified substance: NICKEL</b>  <b>Inhalation:</b>          Nickel and its compounds are on the IARC and NTP lists as posing respiratory cancer risk, and are skin sensitizers with symptoms ranging from slight itch to severe dermatitis.</p>
---	--

**Additional toxicological information under the conditions of use:**

**Acute toxicity**

<p><b>Specified substance: CHROMIUM (VI)</b>          LD50 (oral, rat) = 27 – 59 mg/kg          LC50 (inhalation, rat) = 33 – 70 mg/m<sup>3</sup>/4h</p>	<p><b>Specified substance: CARBON DIOXIDE</b>          LCLo (inhalation, human) = 90000 ppm/5 min.</p> <p><b>Specified substance: CARBON MONOXIDE</b>          LC50 (inhalation, rat) = 1300 mg/l /4h</p>	<p><b>Specified substance: NITROGEN DIOXIDE</b>          LC50 (inhalation, rat) = 88 ppm/4h</p> <p><b>Specified substance: OZONE</b>          LCLo (inhalation, human) = 50 ppm/30 min.</p>
--	---	---

**Carcinogenicity:**

<b>Specified substance: Chromium (VI) or Hexavalent Chromium</b>	
International Agency for Research on Cancer (IARC) Monographs	1 (Carcinogenic to humans)
National Toxicology Program (NTP) Status	Known to be human carcinogen
US OSHA Specifically Regulated Substances (29 CFR 1910.1001-1050)	Cancer
<b>Specified substance: Chromium Oxide</b>	
International Agency for Research on Cancer (IARC) Monographs	3 (Not classifiable as to its carcinogenicity to humans)
<b>Specified substance: Nickel</b>	
International Agency for Research on Cancer (IARC) Monographs	2B (Possibly carcinogenic to humans)
National Toxicology Program (NTP) Status	Reasonably anticipated to be a Human Carcinogen

**Section 12 – ECOLOGICAL INFORMATION**

**Ecotoxicity**

**Acute hazards to the aquatic environment:**

**Fish**

<p><b>Specified substance: NICKEL</b>          LC50 (Fathead minnow (Pimephales promelas), 96 h): 2.916 mg/l          LC50 (Brachydanio rerio), 96 h): &gt;100 mg/l          EC50 (Daphnia magna), 48 h): &gt;100 mg/l          LC50 (Cyprinus carpio) [semi-static], 96 h): 1.3 mg/l          EC50 (Daphnia magna) [static], 48 h): 1 mg/l</p>	<p><b>Specified substance: MOLYBDENUM</b>          LC50 (Rainbow trout, donaldson trout (Oncorhynchus mykiss), 96 h): 800 mg/l</p> <p><b>Specified substance: IRON and/or iron alloys (as Fe)</b>          LC50 (Cyprinus carpio) [semi-static], 96 h): 0.56 mg/l</p>
---	---



**SAFETY DATA SHEET**

Aquatic Invertebrates

<b>Specified substance: NICKEL</b> EC50 (Water flea (Daphnia magna), 48 h): 1 mg/l EC50 (Pseudokirchneriella subcapitata), 72 h): 0.18 mg/l EC50 (Pseudokirchneriella subcapitata) [static], 96 h): 0.174 – 0.311 mg/l	<b>Specified substance: MANGANESE</b> EC50 (Water flea (Daphnia magna), 48 h): 40 mg/l
---	---

**Chronic hazards to the aquatic environment:**

<b>Fish (product):</b>	Not classified
<b>Aquatic Invertebrates (product):</b>	Not classified
<b>Toxicity to Aquatic Plants (product):</b>	Not classified

**Persistence and Degradability**

<b>Biodegradation (product):</b>	No data available
----------------------------------	-------------------

**Bioaccumulative Potential**

<b>Bioconcentration Factor (BCF) (product):</b>	No data available
---	-------------------

<b>Specified substance: NICKEL</b> Zebra mussel(Dreissena polymorpha),Bioconcentration Factor(BCF): 5,000-10,000 (Lotic)Bioconcentration factor calculated using dry weight tissue conc.
---

**Mobility in Soil:** No data available

**Section 13 – DISPOSAL CONSIDERATIONS**

**Waste disposal recommendations:** Prevent waste from contaminating surrounding environment. Discard any product, residue, disposable container or liner in an environmentally acceptable manner, in full compliance with international/federal/state/ local regulations. However, alloy wastes are normally collected to recover metal values.

**Section 14 – TRANSPORT INFORMATION**

In accordance with DOT / ADR / RID / ADNR / IMDG / ICAO / IATA

**14.1 UN number**

Not a dangerous good in sense of transport regulations

**14.2 UN proper shipping name**

Not applicable

**Section 15 – REGULATORY INFORMATION**

**15.1 US Federal regulations**

<b>Chromium (7440-47-3)</b>	<b>Nickel (7440-02-0)</b>
Listed on the United States TSCA (Toxic Substances Control Act) inventory	Listed on the United States TSCA (Toxic Substances Control Act) inventory
Listed on SARA Section 313 (Specific toxic chemical listings)	Listed on SARA Section 313 (Specific toxic chemical listings)
SARA Section 313 - Emission Reporting: <b>1.0 %</b>	SARA Section 313 - Emission Reporting: <b>0.1%</b>
<b>Copper (7440-50-8)</b>	<b>Manganese (7439-96-5)</b>
Listed on the United States TSCA (Toxic Substances Control Act) inventory	Listed on the United States TSCA (Toxic Substances Control Act) inventory
Listed on SARA Section 313 (Specific toxic chemical listings)	Listed on SARA Section 313 (Specific toxic chemical listings)
SARA Section 313 - Emission Reporting: <b>1.0 %</b>	SARA Section 313 - Emission Reporting: <b>1.0 %</b>
<b>Iron (7439-89-6)</b>	<b>Molybdenum (7439-98-7)</b>
Listed on the United States TSCA (Toxic Substances Control Act) inventory	Listed on the United States TSCA (Toxic Substances Control Act) inventory
<b>Silicon (7440-21-3)</b>	
Listed on the United States TSCA (Toxic Substances Control Act) inventory	

**15.2 US State regulations**

<b>Nickel (7440-02-0)</b>				
U.S. - California - Proposition 65 - Carcinogens List <b>YES</b>	U.S. - California - Proposition 65 - Developmental Toxicity	U.S. - California - Proposition 65 - Reproductive Toxicity - Female	U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No significance risk level (NSRL)
U.S. - Massachusetts - Right To Know List		U.S. - New Jersey - Right to Know Hazardous Substance List		
U.S. - Minnesota - Hazardous Substance List		U.S. - Pennsylvania - RTK (Right to Know) List		
<b>Chromium (7440-47-3)</b>		<b>Manganese (7439-96-5)</b>		
U.S. - Massachusetts - Right To Know List		U.S. - Massachusetts - Right To Know List		
U.S. - Minnesota - Hazardous Substance List		U.S. - Minnesota - Hazardous Substance List		
U.S. - New Jersey - Right to Know Hazardous Substance List		U.S. - New Jersey - Right to Know Hazardous Substance List		
U.S. - Pennsylvania - RTK (Right to Know) List		U.S. - Pennsylvania - RTK (Right to Know) List		
<b>Copper (7440-50-8)</b>		<b>Molybdenum (7439-98-7)</b>		
U.S. - Massachusetts - Right To Know List		U.S. - Massachusetts - Right To Know List		
U.S. - Minnesota - Hazardous Substance List		U.S. - Minnesota - Hazardous Substance List		
U.S. - New Jersey - Right to Know Hazardous Substance List		U.S. - New Jersey - Right to Know Hazardous Substance List		
U.S. - Pennsylvania - RTK (Right to Know) List		U.S. - Pennsylvania - RTK (Right to Know) List		
<b>Silicon (7440-21-3)</b>				
U.S. - Massachusetts - Right To Know List		U.S. - New Jersey - Right to Know Hazardous Substance List		
U.S. - Minnesota - Hazardous Substance List		U.S. - Pennsylvania - RTK (Right to Know) List		

**SAFETY DATA SHEET**



**Section 16 – OTHER INFORMATION**

**SUPERSEDES LAST REVISION:** 03/15/2018 (SDS)

HMIS RATING (Hazardous Materials Information System)			
Health (blue) - 2	Flammability (red) - 0	Reactivity (yellow) - 0	Protective Equipment - X (See Sections 4, 8 & 10)

**Health Hazard:** 0 (minimal acute or chronic exposure hazard); 1 (slight acute or chronic exposure hazard); 2 (moderate acute or significant chronic exposure hazard); 3 (severe acute exposure hazard; one time overexposure can result in permanent injury and may be fatal); 4 (extreme acute exposure hazard; onetime overexposure can be fatal).

**Flammability Hazard:** 0 (minimal hazard); 1 (materials that require substantial pre-heating before burning); 2 (combustible liquid or solids; liquids with a flash point of 38-93°C [100-200°F]); 3 (Class IB and IC flammable liquids with flash points below 38°C [100°F]); 4 (Class IA flammable liquids with flash points below 23°C [73°F] and boiling points below 38°C [100°F]).

**Reactivity Hazard:** 0 (normally stable); 1 (material that can become unstable at elevated temperatures or which can react slightly with water); 2 (materials that are unstable but do not detonate or which can react violently with water); 3 (materials that can detonate when initiated or which can react explosively with water); 4 (materials that can detonate at normal temperatures or pressures).

**Caution:** HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks. Although HMIS® ratings are not required on SDS's under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used only in conjunction with a fully implemented HMIS® program by workers who have received appropriate HMIS® training. HMIS® is a registered trade and service mark of the NPCA.


**NATIONAL FIRE PROTECTION ASSOCIATION:**

**Health Hazard:** 0 (material that on exposure under fire conditions would offer no hazard beyond that of ordinary combustible materials); 1 (materials that on exposure under fire conditions could cause irritation or minor residual injury); 2 (materials that on intense or continued exposure under fire conditions could cause temporary incapacitation or possible residual injury); 3 (materials that can on short exposure cause serious temporary or residual injury); 4 (materials that under very short exposure causes death or major residual injury).

**Flammability Hazard:** Refer to definitions for "HMIS RATING (Hazardous Materials Information System)"

**Reactivity Hazard:** Refer to definitions for "HMIS RATING (Hazardous Materials Information System)"

**NFPA RATING**

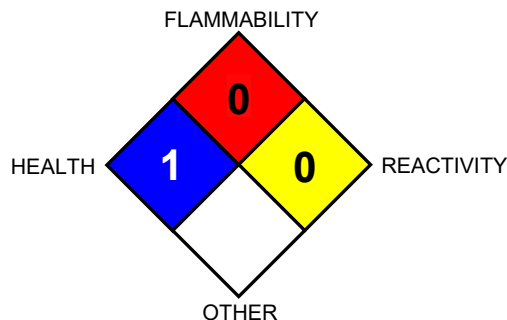

**DEFINITIONS OF TERMS**

- CAS No.** - Chemical Abstracts Service Number
- OSHA** - U.S. Occupational Safety and Health Administration
- PEL** - Permissible Exposure Level
- TLV** - Threshold Limit Value
- TWA** - Time Weighted Average
- STEL** - Short Term Exposure Limit
- NIOSH** - National Institute of Occupational Safety and Health
- ACGIH** - American Conference of Governmental Industrial Hygienists

- TDLo** - the lowest dose to cause a symptom
- TCLo** - the lowest concentration to cause a symptom
- LD50 & LC50** - These values are the amount of a substance given to the stated species that causes 50% of that species to die.
- SARA** - Superfund Amendments and Reauthorization Act
- IARC** - International Agency for Research on Cancer
- GHS** - Globally Harmonized System

**Full text of H-phrases (from Section 2)**

<b>Acute Tox. 4 (Oral)</b>	Acute toxicity (oral), Category 4
<b>Aquatic Acute 1</b>	Hazardous to the aquatic environment — Acute Hazard, Category 1
<b>Aquatic Chronic 3</b>	Hazardous to the aquatic environment — Chronic Hazard, Category 3
<b>Carc. 1B</b>	Carcinogenicity, Category 1B
<b>Skin Sens. 1</b>	Sensitisation — Skin, category 1
<b>STOT RE 1</b>	Specific target organ toxicity — Repeated exposure, Category 1
<b>H302</b>	Harmful if swallowed
<b>H317</b>	May cause an allergic skin reaction
<b>H350</b>	May cause cancer
<b>H372</b>	Causes damage to organs through prolonged or repeated exposure
<b>H400</b>	Very toxic to aquatic life
<b>H412</b>	Harmful to aquatic life with long lasting effects

**DISCLAIMER OF EXPRESSED AND IMPLIED WARRANTIES:** Crown Alloys Company urges each end user and recipient of this SDS to study it carefully. If necessary, consult an industrial hygienist or other expert to understand this information and safeguard the environment and protect workers from the potential hazards associated with the handling or use of this product. The information in this document is believed to be correct as of the date issued. However, this information is provided without any representation or warranty, expressed or implied, regarding accuracy or correctness. The conditions or methods of handling, storage, use and disposal of the product are beyond our control and may be beyond our knowledge. For this and other reasons we do not assume responsibility and expressly disclaim liability of loss, damage, or expense arising from it or any way connected with the handling, storage, use, or disposal of this product. Data may be changed from time to time. Be sure to consult the latest edition of the SDS. Compliance with all applicable Federal, State, Provincial and local laws and regulations remain the responsibility of the user.